



Product Name: Perfect 10
Process: Select / Print on
Material: Poly Knit 9 / 1/4" Sintra
Effective Date: 03/20/2012

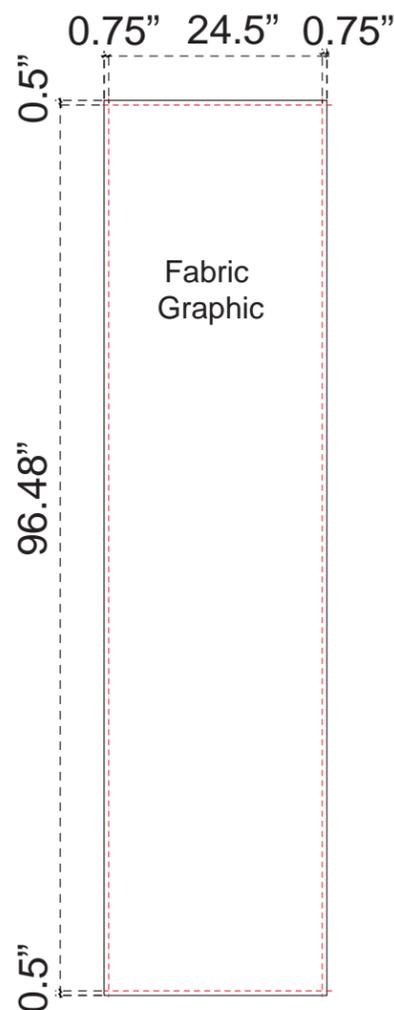

Live Area: 23"w x 95.48"h  
with 0.75" bleed TOP  
0.5" bleed SIDES  
Finished Size: 24.5"w x 96.48"h

Sew hook Velcro into front perimeter of graphic

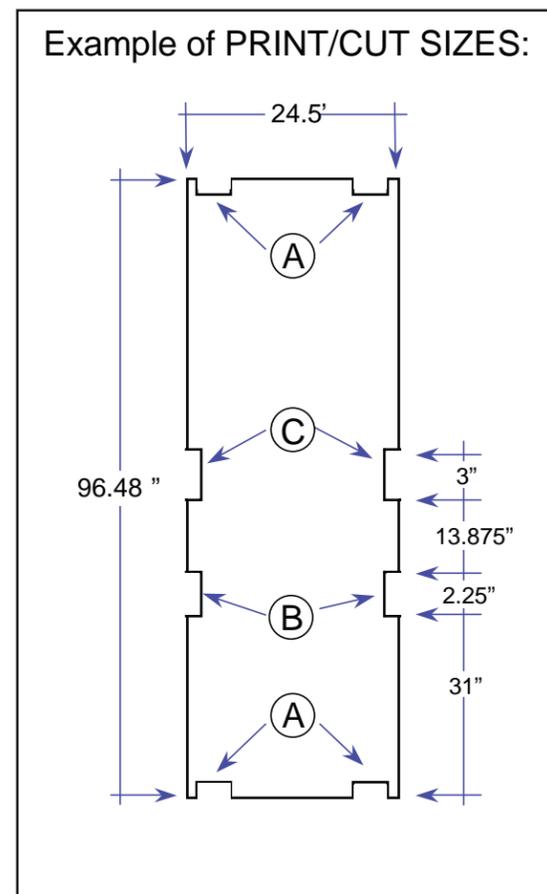

### Finishing


Sew 1/2" Velcro to front perimeter of graphic

A - The 4 corner notches are cut 1/2" in from the edge and 1/4"h x 3/4"w

B - For the side notches - measure 31" up from the bottom of the graphic. Notch is 2.25"h x 0.25"w.

C - Measure up an additional 13.875" from the top edge of the first notch. Notch is 3"h x 0.25"w

Notch is 3"h x 0.25"w

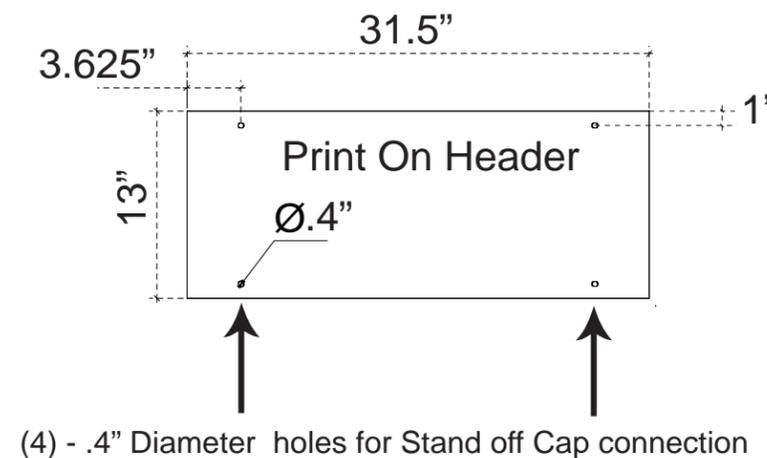



(4) - .4" Diameter holes for Stand off Cap connection

**NOTE: Graphic files must be @ 150 dpi Finished Size. DO NOT send Flattened Files. Production can not manipulate the content, proportion or color of these files.**

**NOTE: These dimensions are for graphic layout purposes. Graphic needs to be cut and test fitted to P10 frame.**

*A small portion of your graphic(s) may be hidden by P10 accessories, such as Monitors and Headers. Please use these diagrams to position your graphics correctly.*

Product Name: Perfect 10
Process: Select / Print on
Material: Poly Knit 9 / 1/4" Sintra
Effective Date: 03/20/2012

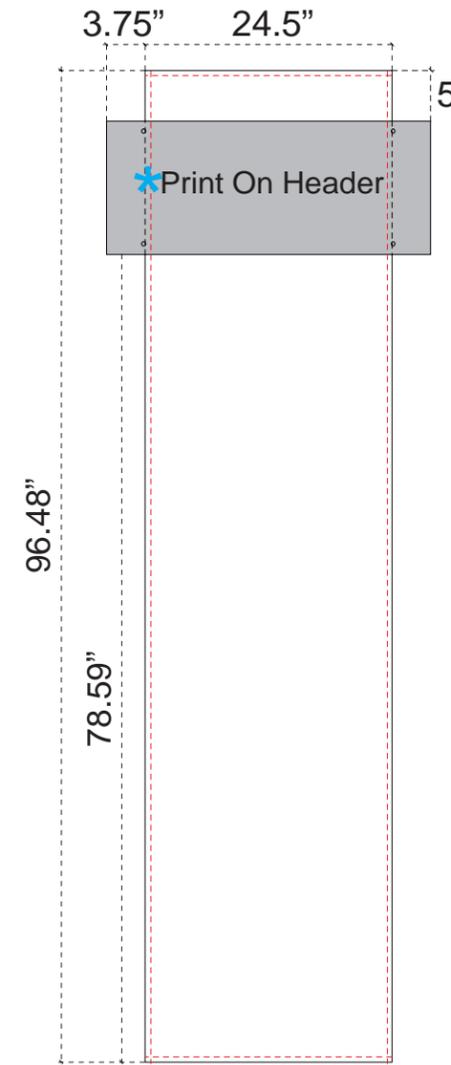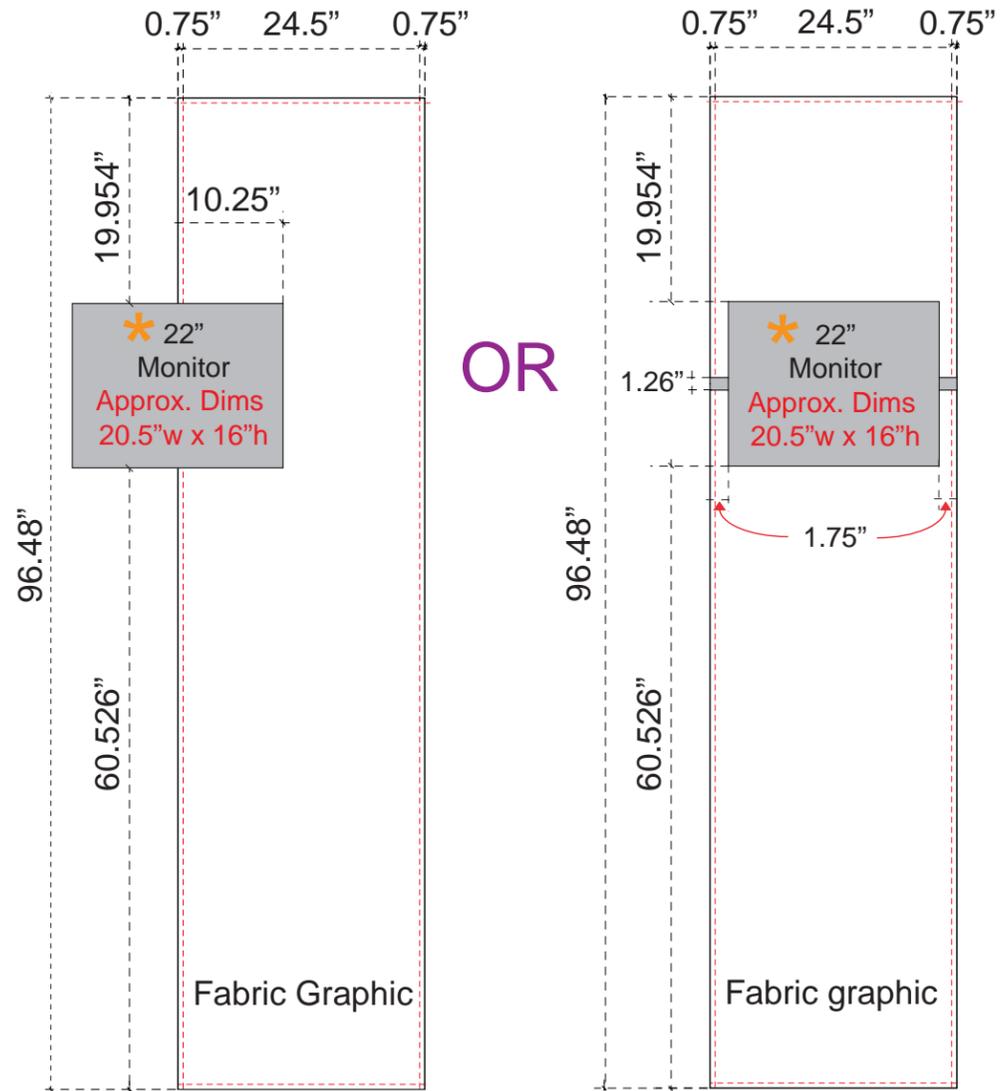

\* Note: When adding Monitors to the P10 unit, a portion of the graphic will be covered. Please design graphic layout according to desired Monitor Location.

\* Note: When using Headers with the P10 unit a portion of the graphics will be covered. Please design graphic layout according to desired Header shape.

*Note: Please refer to Banner Stand Graphic Dims page for complete instructions for Fabric Graphic.*